



HIPOST™ OPERATING GUIDELINES - SERIES 12_1R, 12_1G

RPM Calculation

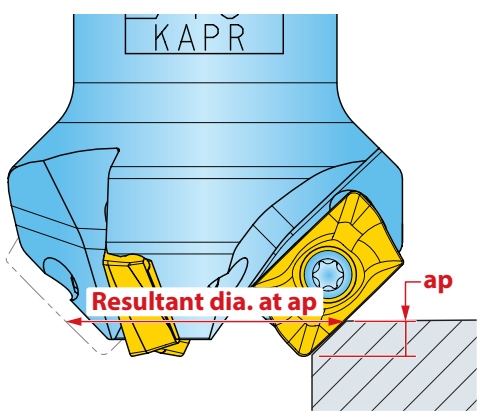

Calculation is to be made using the resultant diameter at ap.

Chip Thinning

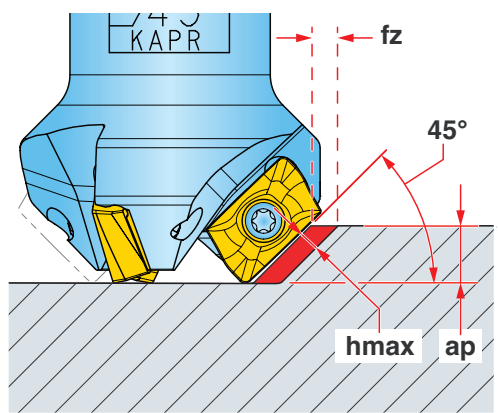

Chip Thinning Calculator is recommended to ensure hmax falls within fz range.

ISO	Materials			V _c Cutting Speed SFM	f _z Feed/Tooth (inch)	Harder <-----> Tougher											Coolant			
	Mat'l Group #VDI 3323	Type	Examples			IN90D	IN2504	IN2540	IN10K	IN2510	IN2505	IN2005	IN4030	IN2530	IN1030	IN7035		IN6535	IN2035	IN2036
P	1 thru 5	Non-alloy Steel	1018, A36, 1045, A572, 1070	400-1000	.003-.007															NO
	6 thru 9	Low-alloy Steel	4140, 4340, P20, 8620, 300M	350-700		5	4			3	2							1		
	10, 11	High-alloy Steel	H13, A2, D2, M2, T1	300-600																
M	12 thru 13	Stainless Steel (Ferritic & Martensitic)	410, 416, 440	350-600	.003-.006														May not be required at high speeds	
	14	Stainless Steel (Austenitic)	303, 304, 316, 15-5, 17-4	300-550			5			4	3	2	1							
K	15 thru 16	Gray Cast Iron	CLS. 20, 30, 45	500-1000	.003-.007														NO	
	17 thru 20	Nodular Cast Iron	60-40-18, 100-70-03	400-800		1			2	4								3		
N	21 thru 30	Aluminum	7075, 6061	1000-3000	.003-.008	1			1										YES	
S	31 thru 35	High-Temp Alloys	Inconel, Hastelloy, Nimonic, Monel	65-150	.003-.005						3	4	2	1						
	36 thru 37	Titanium Alloys	6Al-4V, 5Al-5Mo-5V-3Cr	85-200						4	3	2	1							
H	38 thru 39	Hardened Steel >48	A2, 01, D2	130-250	.003-.004	1				2									NO	

Note: Feed and speed recommendations are starting operating parameters. They are only guidelines from which further optimization should take place. Operating parameters are influenced by many machining variables. These variables may cause for reductions in feeds and speed or dramatic increases. Additionally, DOC and WOC may need to be revised to optimize the tools performance.