




HIPOSTRIO™ 10 OPERATING GUIDELINES

Chip Thinning

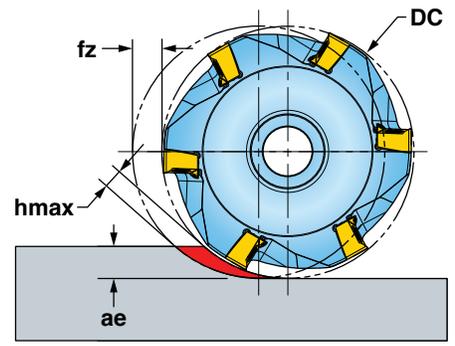

* When ae is less than 25% DC, recommend use of Chip Thinning Calculator to ensure hmax falls within fz range.

Materials				Vc Cutting Speed SFM	fz* Feed/Tooth (inch)	Harder.....Tougher										Coolant											
ISO	Mat'l Group #VDI 3323	Type	Examples			DLC	Carbide																				
						IN3310	IN2504	IN2540	IN10K	IN2510	IN2505	IN4030	IN2530	IN1030	IN6537		IN2036										
P	1 thru 5	Non-alloy Steel	1018, A36, 1045, A572, 1070	400-1000																							
	6 thru 9	Low-alloy Steel	4140, 4340, P20, 8620, 300M	350-700	.003-.008			4			3	2	1											No			
	10, 11	High-alloy Steel	H13, A2, D2, M2, T1	300-600																							
M	12 thru 13	Stainless Steel (Ferritic & Martensitic)	410, 416, 440	350-600																				Yes			
	14	Stainless Steel (Austenitic)	303, 304, 316, 15-5, 17-4	300-550	.003-.006			4			3	2												1	May not be required at high speeds		
K	15 thru 16	Gray Cast Iron	CLS. 20, 30, 45	500-1000																							
	17 thru 20	Nodular Cast Iron	60-40-18, 100-70-03	400-800	.003-.008		2			1	3													4	No		
N	21 - 30	Aluminum	7075, 6061	1000-3000																							
				1500-4500	.003-.010				1																	Yes	
S	31 thru 35	High-Temp Alloys	Inconel, Hastelloy, Nimonic, Monel	65-200																							
	36 thru 37	Titanium Alloys	6Al-4V, 5Al-5Mo-5V-3Cr	85-200	.003-.005																				2	3	1
H	38 thru 39	Hardened Steel >48	A2, O1, D2	130-250	.003-.005		1																		2	No	

Note: Feed and speed recommendations are starting operating parameters. They are only guidelines from which further optimization should take place. Operating parameters are influenced by many machining variables. These variables may cause for reductions in feeds and speed or dramatic increases. Additionally, DOC and WOC may need to be revised to optimize the tools performance.