


## OPERATING GUIDELINES - SERIES 1K\_1B

## RPM Calculation Resultant dia. at ap

Calculation is to be made using the resultant diameter at ap.

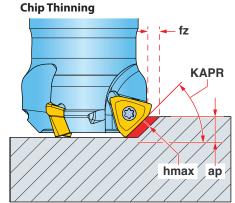

Chip Thinning calculator is recommended to ensure hmax falls within fz range

Materials				Vc	fz*	HarderTougher		
ISO	Mat'l Group #VDI 3323	Туре	Examples	Cutting Speed SFM	Feed/Tooth (inch)	IN2505	IN2530	Coolant
P	1 thru 5	Non-alloy Steel	1018, A36, 1045, A572, 1070	400-1000	.00150030	2	1	No
	6 thru 9	Low-alloy Steel	4140, 4340, P20, 8620, 300M	350-700				
	10, 11	High-alloy Steel	H13, A2, D2, M2, T1	300-600				
M	12 thru 13	Stainless Steel (Ferritic & Martensitic)	410, 416, 440	400-700	.00150030	2	1	May not be required at high speeds
	14	Stainless Steel (Austenitic)	303, 304, 316, 15-5, 17-4	300-600				
K	15 thru 16	Gray Cast Iron	CLS. 20, 30, 45	500-1000	.00150035	1	2	No
	17 thru 20	Nodular Cast Iron	60-40-18, 100-70-03	400-800				
S	31 thru 35	High-Temp Alloys	Inconel, Hastelloy, Nimonic, Monel	75-120	.00150030	2	1	Yes
	36 thru 37	Titanium Alloys	6Al-4V, 5Al-5Mo-5V-3Cr	100-150		1	2	

Note: Feed and speed recommendations are starting operating parameters. They are only guidelines from which further optimization should take place. Operating parameters are influenced by many machining variables. These variables may cause for reductions in feeds and speed or dramatic increases. Additionally, DOC and WOC may need to be revised to optimize the tools performance.

